

Work Order ID 131322

Thursday, April 02, 2015 11:51:49 AM

131322

Page 1

Item ID: D119-796-241TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 4/2/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 4/2/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 150402 Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D119-796-241	F

100

100

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

0.00

Memo

0.00

1-Fill tube with sand & install plugs on both ends as per Folio FB298

2-Turn first side as per Folio FB298

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: 7

DWG REV: 7

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 ϕ

mml
15/04/06

110

110

QC

Quality Control

QC1- Inspection performed by CMM

0.00

Memo

0.00

1 ϕ

mml
15/04/07

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				Completed By			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : ☐											

Work Order ID 131322

Thursday, April 02, 2015 11:51:49 AM

131322

Page 2

Item ID: D119-796-241TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 4/2/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 4/2/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FB298

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: AADWG REV: F

3-Remove sand and plugs

4- scribe batch # and part # as per dwg

1 ϕ

mm, L
15/04/08

130

QC1- Inspection performed by CMM

0.00

130

QC

Memo

0.00

Quality Control

1 ϕ

mm, L
15/04/08

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 131322

Thursday, April 02, 2015 11:51:49 AM

131322

Page 3

Item ID: D119-796-241TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 4/2/2015 Start Qty: 1.00 ***1***

Required Date: 4/2/2015 Req'd Qty: 1.00 ***1***

Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00				1	0		DAS 47 9-89
Quality Control									15-04-10
145		0.00							
145									
Crosstubes	Memo	0.00							BC 15/04/13
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								W 15-04-13
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								BC

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Picklist Print

Thursday, April 02, 2015 11:51:53 AM

Page 1

Work Order ID: 131322

131322

Parent Item: D119-796-241TRN

D119-796-241TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 4/2/2015

Required Date: 4/2/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV A RQ 14/05/27 VERIFIED BY DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6009-129		Manufactured	No			100	Each	47.5000	1	1			
D6009-129													
Crosstube Material													

Location

Loc Qty

Loc Code

LG003

47.5

107864

22.5

107865

25

1 mmh 15/04/06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐			


DART AEROSPACE LTD		Work Order: 131322
Description: Crosstube Assembly (AW119 MKII Aft)		Part Number: D119-796-241
Inspection Dwg: D119-796-241 Rev: F		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	5.88	+/-0.030	5.88	/		vern	CNC-08
	2.516	+/-0.005	2.518	/		↓	
	2.626	+/-0.005	2.629	/			
	2.627	+/-0.005	2.632	/			
	2.798	+/-0.005	2.801	/			
	2.799	+/-0.005	2.803	/			
	2.989	+/-0.005	2.989	/			
	3.191	+/-0.005	3.195	/			
	3.200	+/-0.005	3.203	/			
SIDE B	5.88	+/-0.030	5.88	/		vern	CNC-08
	2.516	+/-0.005	2.518	/		↓	
	2.626	+/-0.005	2.630	/			
	2.627	+/-0.005	2.632	/			
	2.798	+/-0.005	2.801	/			
	2.799	+/-0.005	2.803	/			
	2.989	+/-0.005	2.989	/			
	3.191	+/-0.005	3.195	/			
	3.200	+/-0.005	3.201	/			
	105.71	+/-0.020	105.730	✓		tape	LG-11

DART AEROSPACE LTD		Work Order: 131322
Description: Crosstube Assembly (AW119 MKII Aft)		Part Number: D119-796-241
Inspection Dwg: D119-796-241 Rev: F		Page 2 of 2

WALL THICKNESS MEASUREMENT

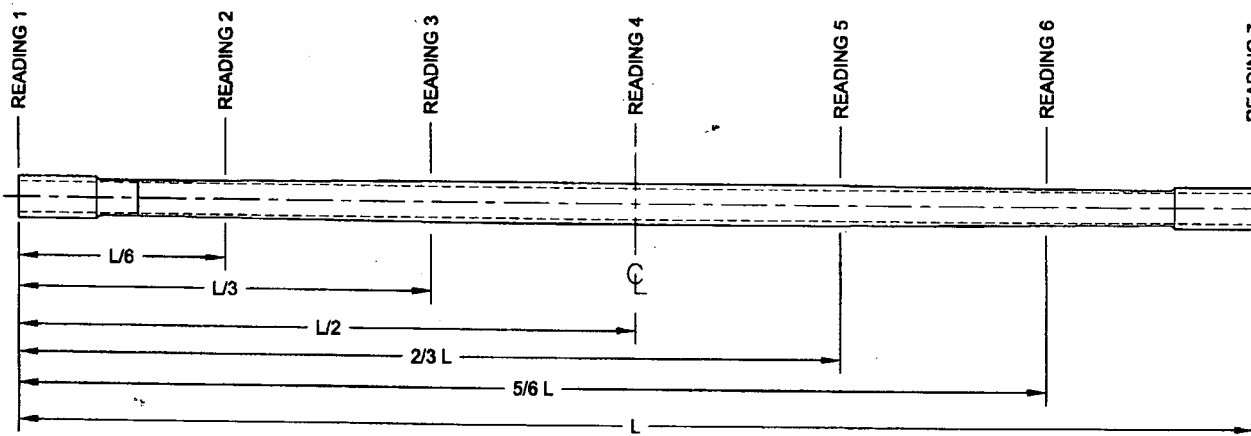

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.143	.143	.151	.154	.008	0.030
READING 2 L= 18	.219	.217	.237	.241	.024	
READING 3 L= 35	.312	.308	.333	.336	.028	0.063 0.048
READING 4 L= 53	.492	.481	.491	.501	.020	
READING 5 L= 71	.309	.291	.329	.338	.039	
READING 6 L= 88	.224	.213	.221	.232	.019	0.030
READING 7 L= 105	.156	.138	.136	.153	.020	

A.P.
15.04.15

Calibration Result

Actual Block Thickness: 100 - 750

DAS 47 Sitiescan 250 Measured Thickness: 100 - 750


Measured by: mmml
Date: 15/04/08

Audited by: DAS 47
Date: 15-04-10

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
A	14.09.18	New Issue (P/O D119-796-201)	KJ	
B	15.03.12	Dimensions updated per Dwg Rev F	KJ	

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-241	XTUBE ASSY (AW119 MKII AFT)
1	1	D119-796-241BND	CROSSTUBE, AFT
2	4	D2873-043	RADIUS BLOCK
3	1	D5122-1	CENTER SUPPORT
4	6	D5123-1	CLAMP CUSHION
5	2	D5123-5	CLAMP CUSHION
6	1	D5134-041	DAMPER SUPPORT ASSY, LH
7	1	D5134-042	DAMPER SUPPORT ASSY, RH
8	1	D5136-1	CONTACT PAD, LH
9	1	D5136-2	CONTACT PAD, RH
10	2	D5152-043	AFT POST MOUNT ASSY
11	16	CR3212-4-07	RIVET, BLIND CSK
12	6	MS21920-25	CLAMP
13	2	MS21920-28	CLAMP

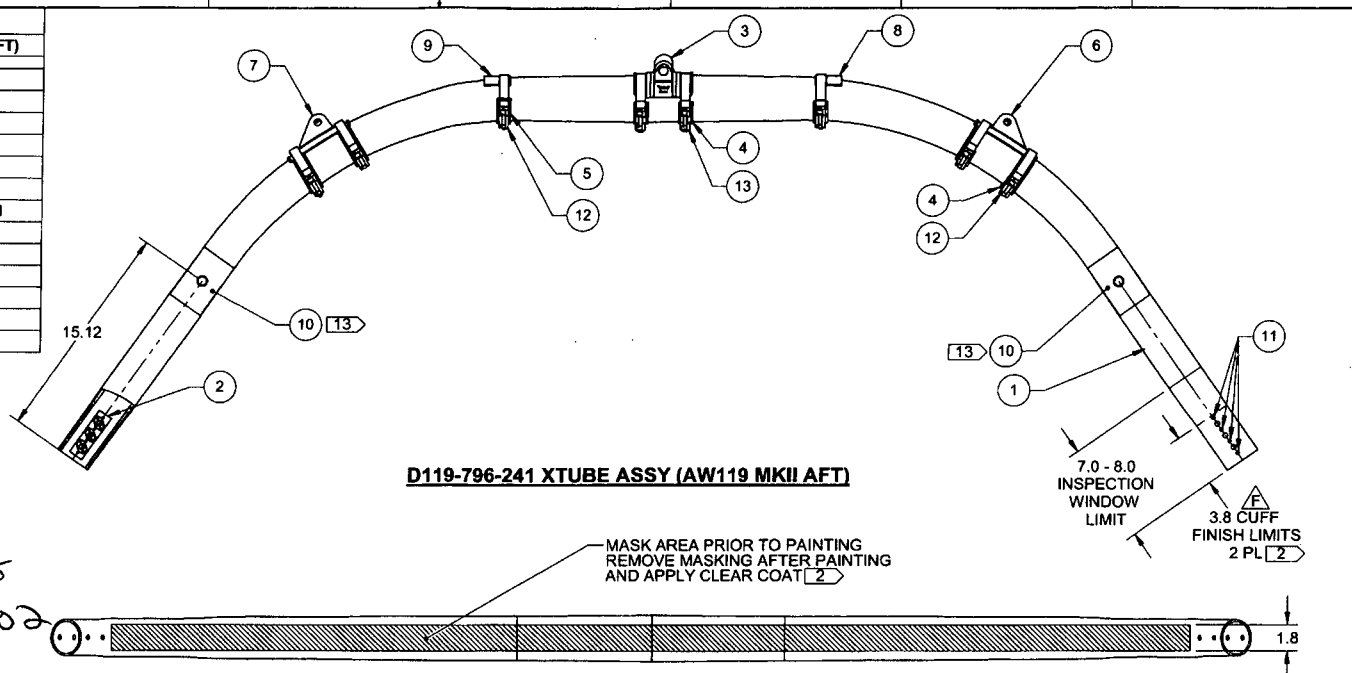

D119-796-241 XTUBE ASSY (AW119 MKII AFT)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: MASK UNDERSIDE OF CROSSTUBE AS SHOWN (B3-1, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY MATTE CLEAR COAT
DO NOT APPLY FINISH (PAINT OR CLEAR COAT) TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-241" AND BATCH NUMBER ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 26.26 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) INSTALL D5122-1 CENTER SUPPORT AT 8.4" OFFSET FROM THE CROSSTUBE BENDING PLANE USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WEED DP460 PER QSI 015. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER DP460 HAS CURED FOR 24 HOURS.
- 10) AFTER FINISHING, ABRASE MATING SURFACES OF D5136-1/2 AND SURFACE OF CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5136-1/2 CONTACT PADS AND INSTALL AT AN 8.4" OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL MS21920-25 CLAMPS AND D5123-5 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) TORQUE MS21920 CLAMPS 80 - 100 IN.-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY. THE NUT HAS NOT BOTTOMED-OUT AFTER TORQUING AND THE NUT IS FACING AFT.
- 12) AFTER FINISHING, POSITION AND INSTALL D5134-041/-042 DAMPER SUPPORTS USING JIG DT10085. ABRASE MATING SURFACES OF THE D5134-041/-042 DAMPER SUPPORTS AND CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5134-041/-042. INSTALL MS21920-25 CLAMPS AND D5123-1 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 13) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-043 WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. INSTALL D5152-043 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.100" MIN THK. LOCATE D5152-043 USING TOOL DT10112.





RELEASED

2015 FEB 09

EN 15-526

F	REMOVED PRIMER/PAINT ON CUFFS, 2.516 WAS 2.500 (C8-5)	AP	15.02.03
F	D5152-043 WAS D5150-3, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER	DB	15.01.15
D	ADD D5150-3 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SH 1, MODIFIED NOTES ON SH 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WAS CR3212-4-05 RIVETS, RADIUS BLOCK WAS NUT PLATE ASSEMBLY (BOM). REMOVED 7.5 DEG CUFF HOLE OFFSET (A1-3), REDUCED CUFF DIA TO 2.500 (C8-5), ADD INSPECTION WINDOW	AP	14.10.23
B	ORIENTATION OF D5122-1 CENTER SUPPORT WAS CORRECTED. D5123-5 ADDED UNDER D5136-1/2 CONTACT PADS. ADDED D2873-043 NUT PLATE ASSY & CR3212-4-05 RIVETS. ADDED REFERENCE TO SKIDTUBES FOR LOCATING CUFF HOLES. RE-ORGANIZED NOTES. REMOVED REDUNDANT INFORMATION.	AP	14.09.08
A	NEW ISSUE	AP	14.08.07
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	DB	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-241	SHEET 1 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

APPROVED

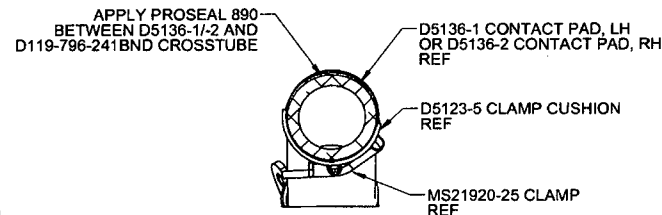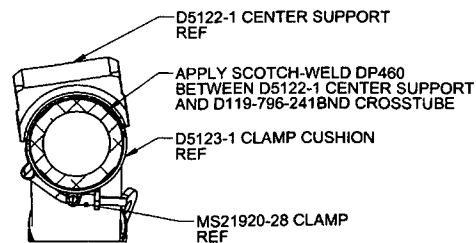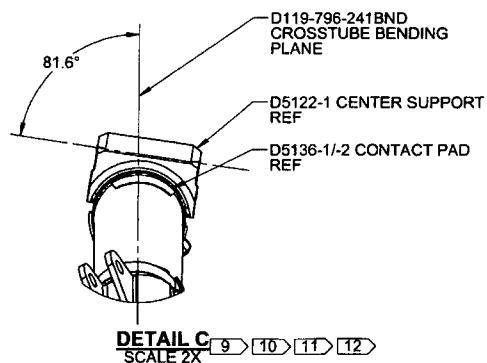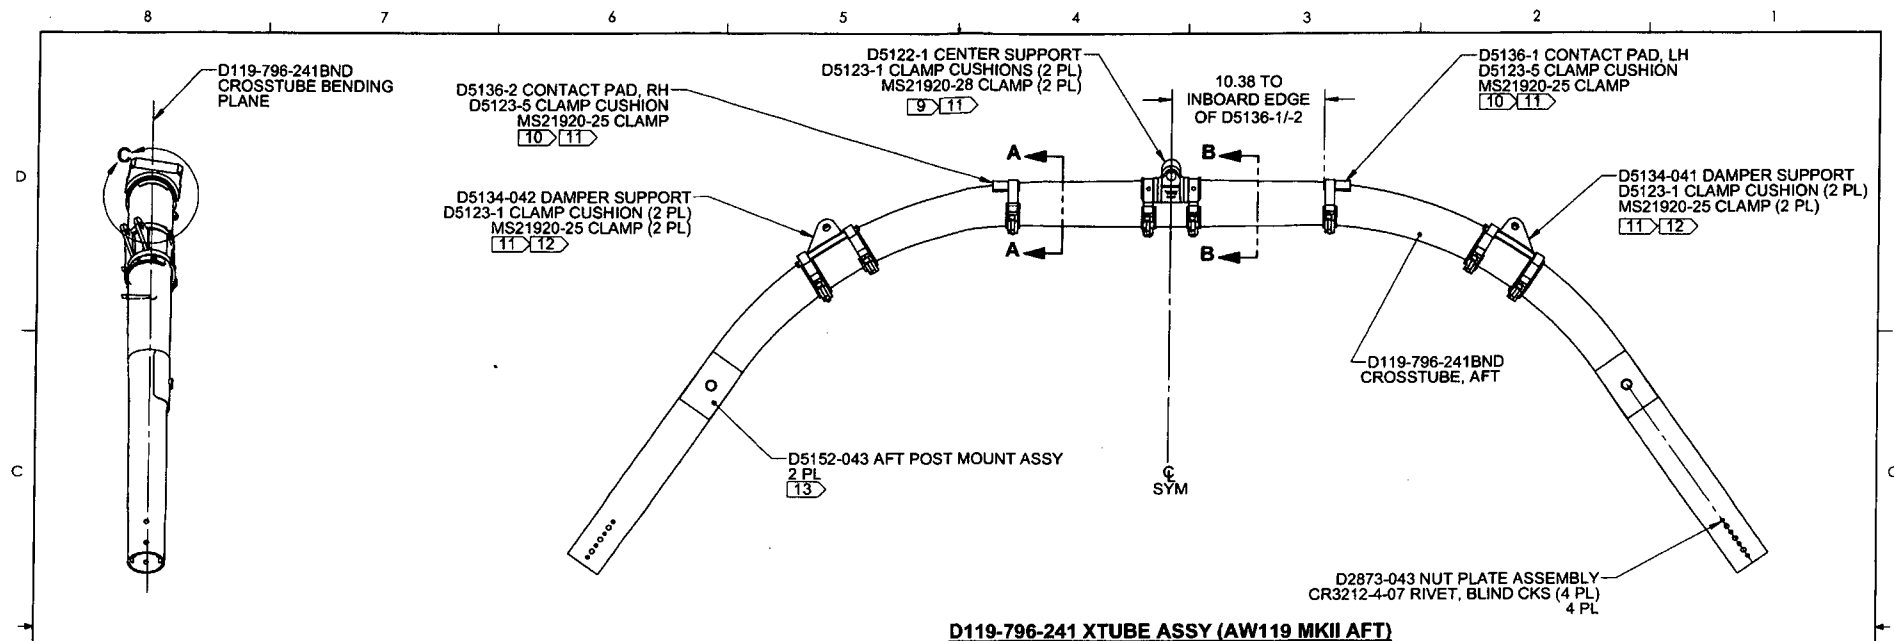


RELEASE

2015 FEB 09

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DB	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-241	SHEET 2 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

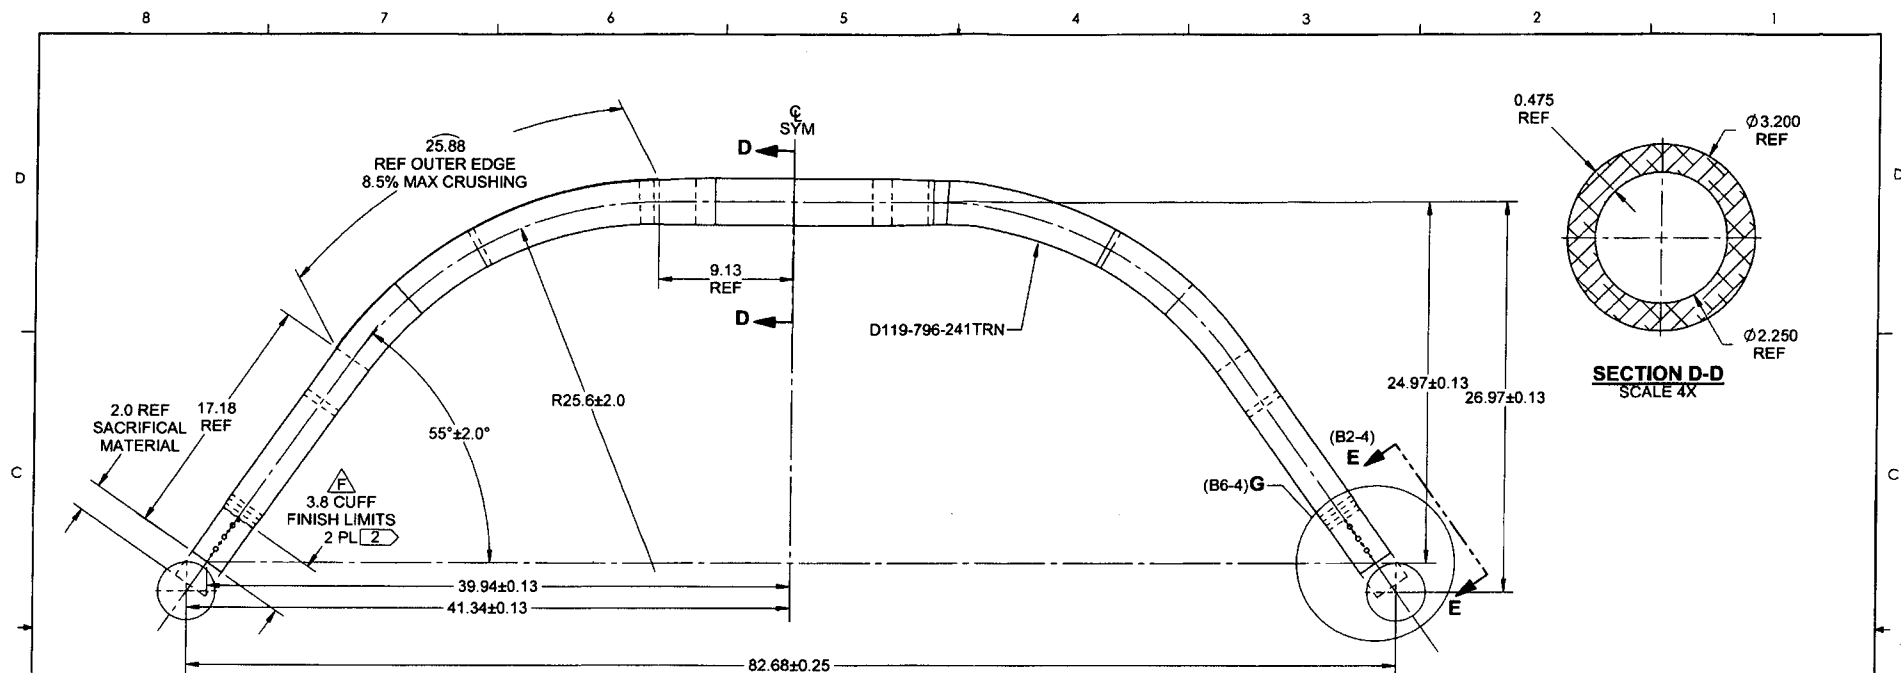

D119-796-241BND CROSSTUBE, AFT 9
BENDING AND DRILLING DETAIL

NOTES:

- 1) MATERIAL: MAKE FROM D119-796-241TRN
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
DO NOT APPLY PRIMER TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 24.17 lbs
- 8) PART IS SYMMETRICAL ABOUT CENTERLINE
- 9) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 8.5% BASED ON OD.
- 10) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

RELEASED

2015 FEB 09

APPROVED	DESIGN	AP	DART AEROSPACE LTD	
	DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
	CHECKED	DB	DRAWING NO.	REV. F
	MFG. APPR.	JLM	D119-796-241	SHEET 3 OF 6
	APPROVED	HS	TITLE	SCALE
	DE APPR.	DS	X-TUBE ASSY (AW119 MKII AFT)	NTS
DATE		15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

